



**HYUNDAI**  
**Technical Service Bulletin**

GROUP <b>RECALL</b>	NUMBER <b>26-01-042H</b>
DATE <b>MAY 2026</b>	MODEL(S) <b>SEE BELOW</b>

**SUBJECT:** FRONT SEAT BELT ANCHOR RETAINER CLIP INSTALLATION  
 (RECALL 298)

**\* IMPORTANT**

Vehicle repairs related to safety recalls are critically important and must be performed properly in accordance with TSB procedures. Review this bulletin in its entirety prior to beginning any repair work.

As required by federal law, dealers must not deliver new vehicles for sale or for lease to customers until all open recalls have been performed. Dealers must also perform all open recalls on used vehicles, demo, and rental vehicles prior to placing them into customer use and whenever an affected vehicle is in the shop for any maintenance or repair.

Access the “Vehicle Information” screen via WebDCS to identify open recalls.

**Description:** For certain Santa Fe (MX5A), Santa Fe Hybrid (MX5A HEV), and IONIQ 6 (CE EV) vehicles, the front seat belt may not be properly secured to the seat frame due to a damaged snap-on anchor(s), which could increase the risk of injury to occupants in the event of a crash. This bulletin provides instructions to install reinforcement clips on the snap-on lower seat belt anchor(s) and if necessary, replace the seat belt.





**Applicable Vehicles (Certain):**

Model Year	Model	Production Dates
2024 – 2026	Santa Fe (MX5A)	12/28/2023 – 10/20/2025
	Santa Fe Hybrid (MX5A HEV)	03/06/2024 – 10/14/2025
2023 – 2025	IONIQ 6 (CE EV)	12/14/2022 – 05/16/2025

**NOTICE**

To avoid any potential damage to IONIQ vehicles, this recall can only be performed at IONIQ certified dealers.

**Parts Information:**

Model	Part Name	Part Number	Figure	Remarks
Santa Fe (MX5A)	Stopper (Clip) – S/Belt	88815-XX000QQH		QTY: 2 per vehicle (clips sold in packs of 10)
Santa Fe Hybrid (MX5A HEV)	S/Belt Assy – FR LH	88810-XXXXX		Replace <b>ONLY</b> if the stopper <b>CANNOT</b> be installed properly  (See <b>step 2</b> below on <b>page 7</b> and <b>NOTE 2</b> under the warranty information for details)
IONIQ 6 (CE EV)	S/Belt Assy – FR RH	88820-XXXXX		

**NOTE:** In the rare case that seat belt replacement is required, use the parts catalog to look up the applicable seat belt part number per ‘VIN.’

**Warranty Information:**

Model	Op. Code	Operation	Op. Time	Causal Part	Nature Code	Cause Code
Santa Fe (MX5A)	61D104R0	Front Seat Belt Anchor Clip Installation (LH/RH)	0.3 M/H	88810-R6000NNB	I11	ZZ6
Santa Fe Hybrid (MX5A HEV)				88810-KL5000NNB		
IONIQ 6 (CE EV)						

**NOTE 1:** Submit claim on Claim Entry Screen as “Campaign” type.

**NOTE 2:** If the seat belt is necessary and needs replacement while performing the repair procedure, and the affected part is still under warranty, the retailer may submit a separate claim using the same repair order. If the seat belt is out of warranty coverage, the retailer should submit a Prior Approval (PA) Request for goodwill consideration before performing the repair.

**NOTE 3:** If any part(s) not subject to this TSB are found in need of replacement while performing the repair procedure, and the affected part(s) are still under warranty, the retailer may submit a separate claim using the same repair order. If the part(s) not subject to this TSB are out of warranty coverage, the retailer has the option to submit a Prior Approval (PA) Request for goodwill consideration on a case-by-case basis.

**NOTE 4:** This TSB includes repair validation photos. Op times include VIN, mileage, and repair validation photo(s) as outlined in the Digital Documentation Policy.

**NOTE 5:** The incident parts are subject to callback through the normal Warranty Technical Center (WTC) parts return process. **Claim is subject to debit if the part is not returned.**

**Service Procedure:**

**DIGITAL DOCUMENTATION**




This TSB includes repair validation photos. Refer to the latest Warranty Digital Documentation Policy for requirements.

**NOTICE**

Applying the recommended torque to all fasteners is essential to reduce potential issues from occurring after the service procedure.

**i Information**

Refer to the QR code or link below for guided video information:  
[Front Seat Belt Anchor Retainer Clip Installation](#)


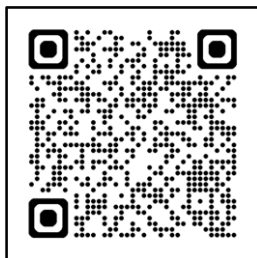


**Table of Contents**

- Front Seat Belt Snap-On Anchor Retainer Clip Installation (LH/RH) .....5
- Front Seat Belt Replacement .....8

**Front Seat Belt Snap-On Anchor Retainer Clip Installation (LH/RH)**


1. Move the front seat to the most forward and upward position to locate the snap-on lower seat belt anchor (A).

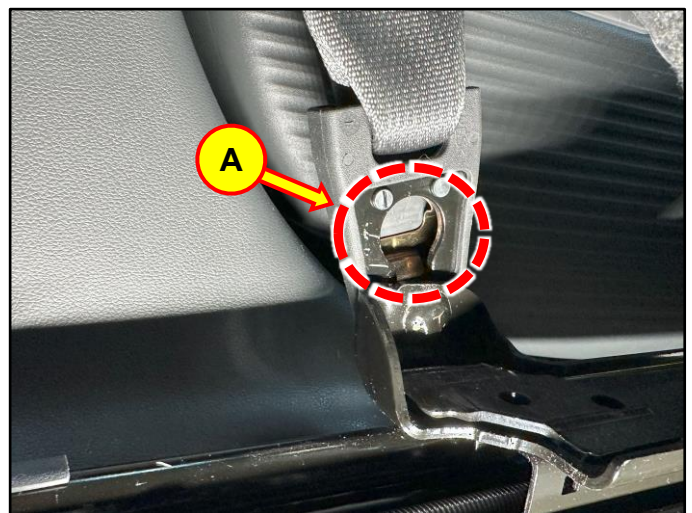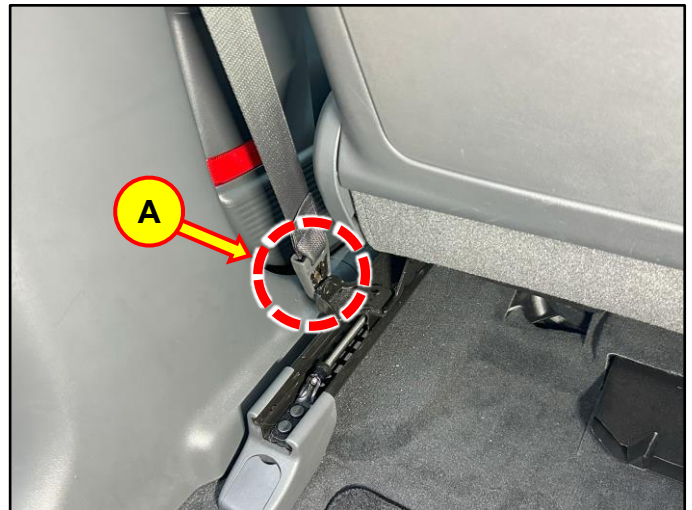

2. Install the retainer clip (B) by inserting it into the circular anchor opening and firmly pressing until fully seated.




**i** **Information**

The retainer clip has a vertical direction, so ensure that it is mounted accordingly.

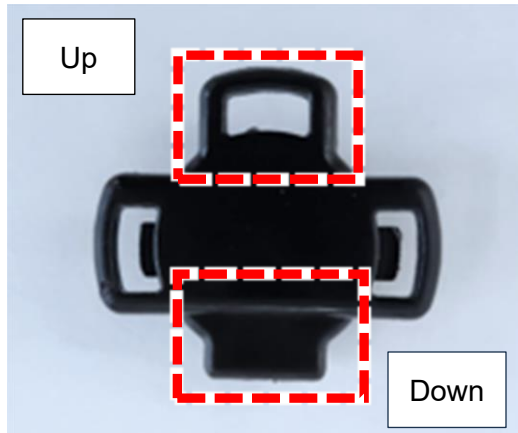

Ensure that the retainer clip's tab does not roll outward from the bracket hole during mounting.

Even if the metal tab from inside the seat belt anchor is broken or bent, proceed with the retainer clip installation.

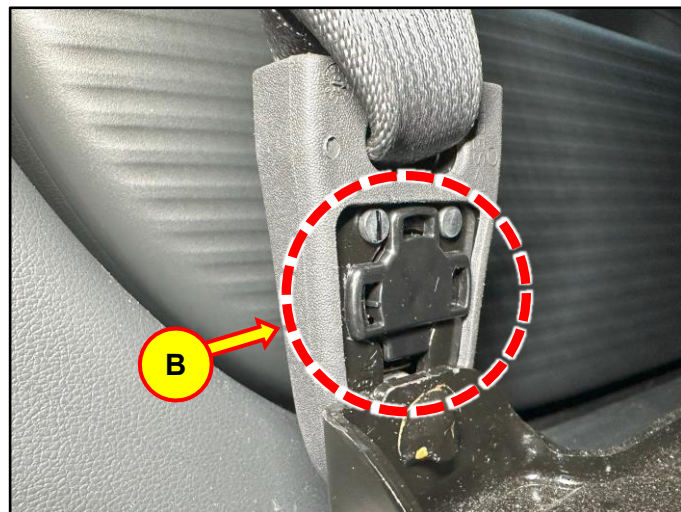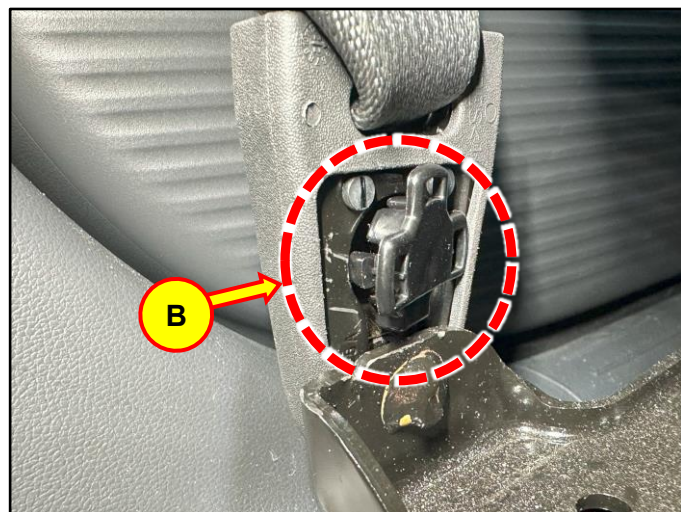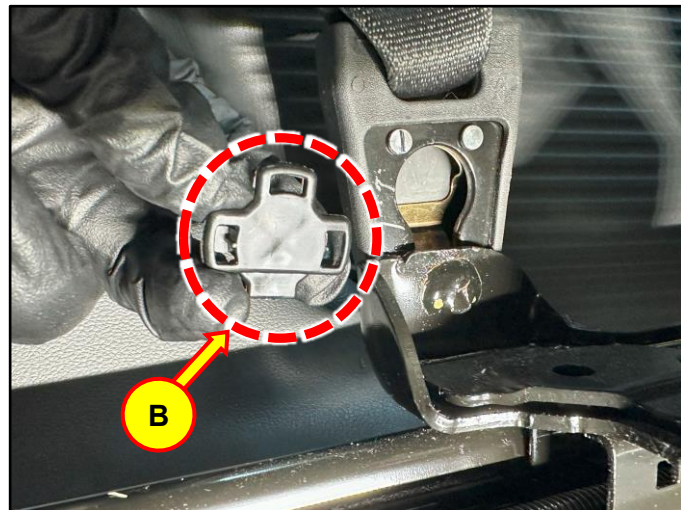


3. Push the retainer clip into the snap ring anchor until it is completely seated against the anchor surface.

**i Information**

If a gap is present, reinsert the retainer clip and push again until it is fully seated.

- **PASS:** If the retainer clip is fully seated, proceed to **step 4**.
- **FAIL:** If the retainer clip **CANNOT** be seated flush after reinserting, proceed to the [Front Seat Belt Replacement](#) section.

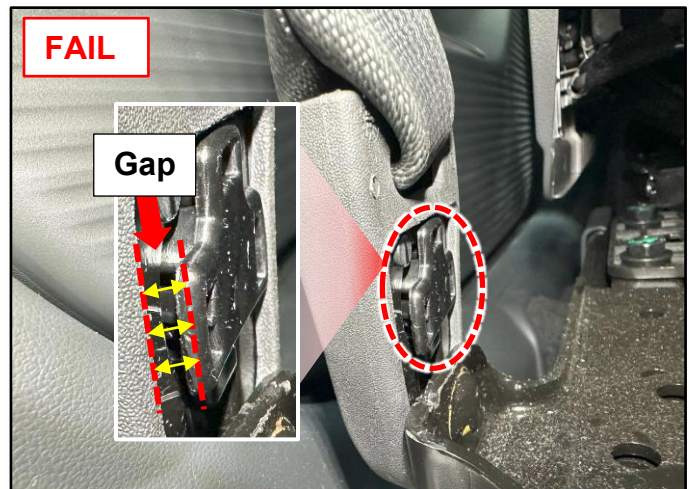

- 4.

**DIGITAL DOCUMENTATION**



Using the STUI camera function, take a photo of the installed retainer clip.

Upload the photo to STUI.

**NOTE:** If the STUI camera function is **NOT** used, write the last 6 digits of the VIN and date of repair on a piece of paper to include in the photo.



5. Repeat **steps 1-3** on the opposite side of the vehicle and take a digital documentation picture of the installed retainer clip of the opposite side.
6. The service procedure is now complete.

**Front Seat Belt Replacement**

1. Disconnect the **12V** negative (-) battery terminal (A):


Model	Remove Part	Location
MX5A & CE EV	Negative (-) Terminal	Engine bay
MX5A HEV		Tailgate area underneath luggage mat



**Tightening Torque:**

lb-ft	7.2
lb-in	86
N.m	8.8

2. Remove the front seat belt by referring to the shop manual:
  - **Body (Interior / Exterior / Electrical) > Seat Belt > Front Seat Belt Pretensioner > Removal**
3. Install the new front seat belt in the reverse order of the removal process, then reconnect the **12V** negative (-) battery terminal.
4. Install the retainer clip (B).

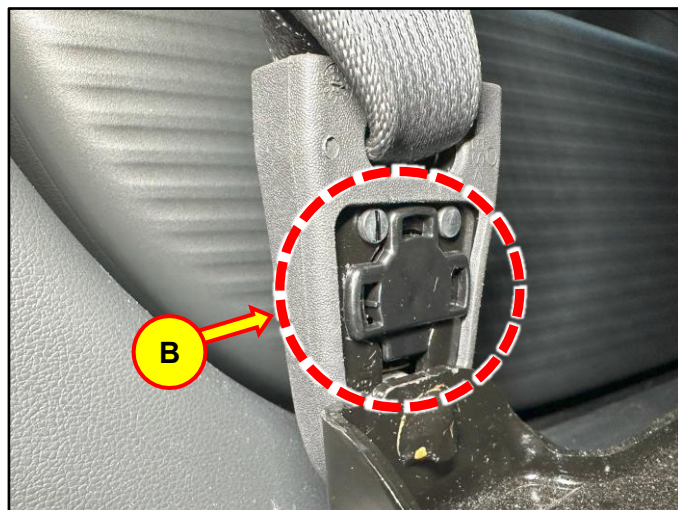

5.

**DIGITAL  
DOCUMENTATION**



Using the STUI camera function, take a photo of the faulty seat belt next to the new seat belt with the retainer clip installed.

Upload the photo to STUI.

**NOTE:** If the STUI camera function is **NOT** used, write the last 6 digits of the VIN and date of repair on a piece of paper to include in the photo.



6. If **BOTH** front seat belts are in need of replacement, repeat **steps 1-5** on the opposite side of the vehicle.
7. The service procedure is now complete.